

# Proposed Rules

Federal Register

Vol. 75, No. 50

Tuesday, March 16, 2010

This section of the FEDERAL REGISTER contains notices to the public of the proposed issuance of rules and regulations. The purpose of these notices is to give interested persons an opportunity to participate in the rule making prior to the adoption of the final rules.

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2010-0228; Directorate Identifier 2009-NM-252-AD]

RIN 2120-AA64

#### Airworthiness Directives; McDonnell Douglas Corporation Model MD-11 and MD-11F Airplanes

**AGENCY:** Federal Aviation Administration (FAA), DOT.

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for certain Model MD-11 and MD-11F airplanes. This proposed AD would require a one-time inspection to detect damage of the wire assemblies of the tail tank fuel system, a wiring change, and corrective actions if necessary. This proposed AD results from fuel system reviews conducted by the manufacturer. We are proposing this AD to detect and correct a potential of ignition sources inside fuel tanks, which, in combination with flammable vapors, could result in a fuel tank fire or explosion, and consequent loss of the airplane.

**DATES:** We must receive comments on this proposed AD by April 30, 2010.

**ADDRESSES:** You may send comments by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* 202-493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this proposed AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, 3855 Lakewood Boulevard, MC D800-0019, Long Beach, California 90846-0001; telephone 206-544-5000, extension 2; fax 206-766-5683; e-mail [dse.boecom@boeing.com](mailto:dse.boecom@boeing.com); Internet <https://www.myboeingfleet.com>. You may review copies of the referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue, SW., Renton, Washington. For information on the availability of this material at the FAA, call 425-227-1221 or 425-227-1152.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone 800-647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

**FOR FURTHER INFORMATION CONTACT:** Serj Harutunian, Aerospace Engineer, Propulsion Branch, ANM-140L, FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California 90712-4137; telephone (562) 627-5254; fax (562) 627-5210.

#### SUPPLEMENTARY INFORMATION:

##### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2010-0228; Directorate Identifier 2009-NM-252-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any

personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

#### Discussion

The FAA has examined the underlying safety issues involved in fuel tank explosions on several large transport airplanes, including the adequacy of existing regulations, the service history of airplanes subject to those regulations, and existing maintenance practices for fuel tank systems. As a result of those findings, we issued a regulation titled "Transport Airplane Fuel Tank System Design Review, Flammability Reduction and Maintenance and Inspection Requirements" (66 FR 23086, May 7, 2001). In addition to new airworthiness standards for transport airplanes and new maintenance requirements, this rule included Special Federal Aviation Regulation No. 88 ("SFAR 88," Amendment 21-78, and subsequent Amendments 21-82 and 21-83).

Among other actions, SFAR 88 requires certain type design (*i.e.*, type certificate (TC) and supplemental type certificate (STC)) holders to substantiate that their fuel tank systems can prevent ignition sources in the fuel tanks. This requirement applies to type design holders for large turbine-powered transport airplanes and for subsequent modifications to those airplanes. It requires them to perform design reviews and to develop design changes and maintenance procedures if their designs do not meet the new fuel tank safety standards. As explained in the preamble to the rule, we intended to adopt airworthiness directives to mandate any changes found necessary to address unsafe conditions identified as a result of these reviews.

In evaluating these design reviews, we have established four criteria intended to define the unsafe conditions associated with fuel tank systems that require corrective actions. The percentage of operating time during which fuel tanks are exposed to flammable conditions is one of these criteria. The other three criteria address the failure types under evaluation: Single failures, single failures in combination with a latent condition(s), and in-service failure experience. For all four criteria, the evaluations included consideration of previous actions taken

that may mitigate the need for further action.

We have determined that the actions identified in this AD are necessary to reduce the potential of ignition sources inside fuel tanks, which, in combination with flammable fuel vapors, could result in fuel tank explosions and consequent loss of the airplane.

An investigation conducted by the airplane manufacturer has revealed that wire assemblies of the tail tank fuel system that are routed together and are in close proximity to the upper surface of the tail tank are a potential ignition source if wire damage occurs. Also, during normal maintenance, wire damage may be caused when maintenance personnel working in the tail tank area inadvertently step on the

wire assemblies. These conditions, if not corrected, could result in burn-through on the upper surface of the tail tank, which could result in a fuel tank explosion, and consequent loss of the airplane.

**Relevant Service Information**

We have reviewed Boeing Alert Service Bulletin MD11-28A124, dated June 17, 2009. The service bulletin describes procedures for doing a general visual inspection of the wire assembly installation of the tail tank fuel system to detect damage of the wire assembly, changing the wiring, and doing corrective actions. Corrective actions include repairing or replacing damaged wire assemblies.

**FAA’s Determination and Requirements of This Proposed AD**

We are proposing this AD because we evaluated all relevant information and determined the unsafe condition described previously is likely to exist or develop in other products of the same type design. This proposed AD would require accomplishing the actions specified in the service information described previously.

**Costs of Compliance**

We estimate that this proposed AD would affect 110 airplanes of U.S. registry. The following table provides the estimated costs for U.S. operators to comply with this proposed AD.

TABLE—ESTIMATED COSTS

| Action              | Work hours     | Average labor rate per hour | Parts          | Cost per product     | Number of U.S.-registered airplanes | Fleet cost         |
|---------------------|----------------|-----------------------------|----------------|----------------------|-------------------------------------|--------------------|
| Inspection .....    | 1 .....        | \$85                        | None .....     | \$85 .....           | 110 .....                           | \$9,350.           |
| Wiring Change ..... | Up to 16 ..... | 85                          | \$11,536 ..... | Up to \$12,896 ..... | Up to 110 .....                     | Up to \$1,418,560. |

**Authority for This Rulemaking**

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. “Subtitle VII: Aviation Programs,” describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in “Subtitle VII, Part A, Subpart III, Section 44701: General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

**Regulatory Findings**

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a “significant regulatory action” under Executive Order 12866,
2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979), and
3. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

You can find our regulatory evaluation and the estimated costs of compliance in the AD Docket.

**List of Subjects in 14 CFR Part 39**

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

**The Proposed Amendment**

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

**PART 39—AIRWORTHINESS DIRECTIVES**

1. The authority citation for part 39 continues to read as follows:

**Authority:** 49 U.S.C. 106(g), 40113, 44701.

**§ 39.13 [Amended]**

2. The FAA amends § 39.13 by adding the following new AD:

**McDonnell Douglas Corporation:** Docket No. FAA-2010-0228; Directorate Identifier 2009-NM-252-AD.

**Comments Due Date**

(a) We must receive comments by April 30, 2010.

**Affected ADs**

(b) None.

**Applicability**

(c) This AD applies to McDonnell Douglas Corporation Model MD-11 and MD-11F airplanes, certificated in any category, as identified in Boeing Alert Service Bulletin MD11-28A124, dated June 17, 2009.

**Subject**

(d) Air Transport Association (ATA) of America Code 28: Fuel.

**Unsafe Condition**

(e) This AD results from fuel system reviews conducted by the manufacturer. The Federal Aviation Administration is issuing this AD to detect and correct a potential of ignition sources inside fuel tanks, which, in combination with flammable vapors, could result in a fuel tank fire or explosion, and consequent loss of the airplane.

**Compliance**

(f) You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

**Action**

(g) Within 60 months after the effective date of this AD, perform a general visual inspection to detect damage of wire assemblies of the tail tank fuel system, in accordance with the Accomplishment Instructions of Boeing Alert Service Bulletin MD11-28A124, dated June 17, 2009.

(1) If no damage is found, before further flight do the wiring change, in accordance with the Accomplishment Instructions of Boeing Alert Service Bulletin MD11-28A124, dated June 17, 2009.

(2) If damage is found, before further flight repair or replace the wire assemblies, and do the wiring changes, as applicable, in accordance with the Accomplishment Instructions of Boeing Alert Service Bulletin MD11-28A124, dated June 17, 2009.

#### Alternative Methods of Compliance (AMOCs)

(h)(1) The Manager, Los Angeles Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. Send information to ATTN: Serj Harutunian, Aerospace Engineer, Propulsion Branch, ANM-140L, FAA, Los Angeles Aircraft Certification Office, 3960 Paramount Boulevard, Lakewood, California 90712-4137; telephone (562) 627-5254; fax (562) 627-5210.

(2) To request a different method of compliance or a different compliance time for this AD, follow the procedures in 14 CFR 39.19. Before using any approved AMOC on any airplane to which the AMOC applies, notify your principal maintenance inspector (PMI) or principal avionics inspector (PAI), as appropriate, or lacking a principal inspector, your local Flight Standards District Office. The AMOC approval letter must specifically reference this AD.

Issued in Renton, Washington, on March 9, 2010.

**Jeffrey E. Duven,**

*Acting Manager, Transport Airplane Directorate, Aircraft Certification Service.*

[FR Doc. 2010-5667 Filed 3-15-10; 8:45 am]

**BILLING CODE 4910-13-P**

## DEPARTMENT OF TRANSPORTATION

### Federal Aviation Administration

#### 14 CFR Part 39

[Docket No. FAA-2010-0260; Directorate Identifier 2010-CE-015-AD]

RIN 2120-AA64

#### Airworthiness Directives; GROB-WERKE (Type Certificate Previously Held by BURKHART GROB Luft- und Raumfahrt) Models G115C, G115D and G115D2 Airplanes

**AGENCY:** Federal Aviation Administration (FAA), Department of Transportation (DOT).

**ACTION:** Notice of proposed rulemaking (NPRM).

**SUMMARY:** We propose to adopt a new airworthiness directive (AD) for the products listed above. This proposed AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of

another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as: The manufacturer has received a report of a failed canopy jettison test, during a regular maintenance check. The investigation revealed that a cable shroud of the jettison system protruded the canopy structure, which probably caused the malfunction. Inability to jettison the canopy in flight would prevent evacuation of the aeroplane in case of need.

The proposed AD would require actions that are intended to address the unsafe condition described in the MCAI.

**DATES:** We must receive comments on this proposed AD by April 30, 2010.

**ADDRESSES:** You may send comments by any of the following methods:

- *Federal eRulemaking Portal:* Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- *Fax:* (202) 493-2251.

- *Mail:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590.

- *Hand Delivery:* U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

#### Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov>; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Office (telephone (800) 647-5527) is in the **ADDRESSES** section. Comments will be available in the AD docket shortly after receipt.

#### FOR FURTHER INFORMATION CONTACT:

Gregory Davison, Aerospace Engineer, FAA, Small Airplane Directorate, 901 Locust, Room 301, Kansas City, Missouri 64106; telephone: (816) 329-4130; fax: (816) 329-4090.

#### SUPPLEMENTARY INFORMATION:

#### Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the **ADDRESSES** section. Include "Docket No. FAA-2010-0260; Directorate Identifier

2010-CE-015-AD" at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD because of those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

#### Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Community, has issued AD No. 2009-0279, dated December 23, 2009 (referred to after this as "the MCAI"), to correct an unsafe condition for the specified products. The MCAI states:

The manufacturer has received a report of a failed canopy jettison test, during a regular maintenance check. The investigation revealed that a cable shroud of the jettison system protruded the canopy structure, which probably caused the malfunction. Inability to jettison the canopy in flight would prevent evacuation of the aeroplane in case of need.

For the reason stated above, this AD mandates an additional one time canopy jettison test and repair if necessary.

You may obtain further information by examining the MCAI in the AD docket.

#### Relevant Service Information

Grob Aircraft AG has issued Service Bulletin No. MSB1078-164, dated July 21, 2009. The actions described in this service information are intended to correct the unsafe condition identified in the MCAI.

#### FAA's Determination and Requirements of the Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with this State of Design Authority, they have notified us of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all information and determined the unsafe condition exists and is likely to exist or develop on other products of the same type design.

#### Differences Between This Proposed AD and the MCAI or Service Information

We have reviewed the MCAI and related service information and, in