

**§ 63.7744**

**40 CFR Ch. I (7–1–08 Edition)**

(1) Inspecting and maintaining each baghouse according to the requirements of § 63.7740(c)(1) through (8) and recording all information needed to document conformance with these requirements; and

(2) If the baghouse is equipped with a bag leak detection system, maintaining records of the times the bag leak detection system sounded, and for each valid alarm, the time you initiated corrective action, the corrective action taken, and the date on which corrective action was completed.

(d) For each wet scrubber that is subject to the operating limits in § 63.7690(b)(2), you must demonstrate continuous compliance by:

(1) Maintaining the 3-hour average pressure drop and 3-hour average scrubber water flow rate at levels no lower than those established during the initial or subsequent performance test;

(2) Inspecting and maintaining each CPMS according to the requirements of § 63.7741(c) and recording all information needed to document conformance with these requirements; and

(3) Collecting and reducing monitoring data for pressure drop and scrubber water flow rate according to the requirements of § 63.7741(f) and recording all information needed to document conformance with these requirements.

(e) For each combustion device that is subject to the operating limit in § 63.7690(b)(3), you must demonstrate continuous compliance by:

(1) Maintaining the 15-minute average combustion zone temperature at a level no lower than 1,300 °F;

(2) Inspecting and maintaining each CPMS according to the requirements of § 63.7741(d) and recording all information needed to document conformance with these requirements; and

(3) Collecting and reducing monitoring data for combustion zone temperature according to the requirements of § 63.7741(f) and recording all information needed to document conformance with these requirements.

(f) For each combustion device that is subject to the operating limit in § 63.7690(b)(4), you must demonstrate continuous compliance by:

(1) Maintaining the 3-hour average combustion zone temperature at a level

no lower than established during the initial or subsequent performance test;

(2) Inspecting and maintaining each CPMS according to the requirements of § 63.7741(d) and recording all information needed to document conformance with these requirements; and

(3) Collecting and reducing monitoring data for combustion zone temperature according to the requirements of § 63.7741(f) and recording all information needed to document conformance with these requirements.

(g) For each acid wet scrubber subject to the operating limits in § 63.7690(b)(5), you must demonstrate continuous compliance by:

(1) Maintaining the 3-hour average scrubbing liquid flow rate at a level no lower than the level established during the initial or subsequent performance test;

(2) Maintaining the 3-hour average pH of the scrubber blowdown at a level no higher than 4.5 (if measured by a CPMS) or maintaining the pH level of the scrubber blowdown during each production shift no higher than 4.5;

(3) Inspecting and maintaining each CPMS according to the requirements of § 63.7741(e) and recording all information needed to document conformance with these requirements; and

(4) Collecting and reducing monitoring data for scrubbing liquid flow rate and scrubber blowdown pH according to the requirements of § 63.7741(f) and recording all information needed to document conformance with these requirements. If the pH level of the scrubber blowdown is measured by a probe and meter, you must demonstrate continuous compliance by maintaining records that document the date, time, and results of each sample taken for each production shift.

[69 FR 21923, Apr. 22, 2004, as amended at 73 FR 7222, Feb. 7, 2008]

**§ 63.7744 How do I demonstrate continuous compliance with the work practice standards that apply to me?**

(a) You must maintain records that document continuous compliance with the certification requirements in § 63.7700(b) or with the procedures in your scrap selection and inspection plan required in § 63.7700(c). Your

records documenting compliance with the scrap selection and inspection plan must include a copy (kept onsite) of the procedures used by the scrap supplier for either removing accessible mercury switches or for purchasing automobile bodies that have had mercury switches removed, as applicable.

(b) You must keep records of the chemical composition of all catalyst binder formulations applied in each furan warm box mold or core making line at a new or existing iron and steel foundry to demonstrate continuous compliance with the requirements in § 63.7700(d).

(c) For a scrap preheater at an existing iron and steel foundry, you must operate and maintain each gas-fired preheater such that the flame directly contacts the scrap charged to demonstrate continuous compliance with the requirement § 63.7700(e)(1). If you choose to meet the work practice standard in § 63.7700(e)(2), you must keep records to document that the scrap preheater charges only material that is subject to and in compliance with the scrap certification requirements in § 63.7700(b).

(d) For a scrap preheater at a new iron and steel foundry, you must keep records to document that each scrap preheater charges only material that is subject to and in compliance with the scrap certification requirements in § 63.7700(b) to demonstrate continuous compliance with the requirement in § 63.7700(f).

**§ 63.7745 How do I demonstrate continuous compliance with the operation and maintenance requirements that apply to me?**

(a) For each capture system and control device for an emissions source subject to an emissions limit in § 63.7690(a), you must demonstrate continuous compliance with the operation and maintenance requirements of § 63.7710 by:

(1) Making monthly inspections of capture systems and initiating corrective action according to § 63.7710(b)(1) and recording all information needed to document conformance with these requirements;

(2) Performing preventative maintenance for each control device according

to the preventive maintenance plan required by § 63.7710(b)(3) and recording all information needed to document conformance with these requirements;

(3) Operating and maintaining each bag leak detection system according to the site-specific monitoring plan required by § 63.7710(b)(4) and recording all information needed to demonstrate conformance with these requirements;

(4) Initiating and completing corrective action for a bag leak detection system alarm according to the corrective action plan required by § 63.7710(b)(5) and recording all information needed to document conformance with these requirements; and

(5) Igniting gases from mold vents according to the procedures in the plan required by § 63.7710(b)(6). (Any instance where you fail to follow the procedures is a deviation that must be included in your semiannual compliance report.)

(b) You must maintain a current copy of the operation and maintenance plans required by § 63.7710(b) onsite and available for inspection upon request. You must keep the plans for the life of the iron and steel foundry or until the iron and steel foundry is no longer subject to the requirements of this subpart.

**§ 63.7746 What other requirements must I meet to demonstrate continuous compliance?**

(a) *Deviations.* You must report each instance in which you did not meet each emissions limitation in § 63.7690 (including each operating limit) that applies to you. This requirement includes periods of startup, shutdown, and malfunction. You also must report each instance in which you did not meet each work practice standard in § 63.7700 and each operation and maintenance requirement of § 63.7710 that applies to you. These instances are deviations from the emissions limitations, work practice standards, and operation and maintenance requirements in this subpart. These deviations must be reported according to the requirements of § 63.7751.

(b) *Startups, shutdowns, and malfunctions.* (1) Consistent with the requirements of §§ 63.6(e) and 63.7(e)(1), deviations that occur during a period of